INSPECTION REPORT



For the Property at: 125 MARIA STREET TORONTO, ON M6P 1W5

Prepared for: IAN BUSHER Inspection Date: Monday, January 20, 2025 Prepared by: Sina Zaman



Canspec Building Services 2984 Range Line Rd Ajax, ON L1S 6V9 1877-226-7732 4169932954

www.canspechome.com jamescan@rogers.com



January 20, 2025

Dear Ian Busher,

RE: Report No. 5961 125 Maria Street Toronto, ON M6P 1W5

Thank you for choosing us to perform your Home Inspection. We trust the experience was both useful and enjoyable.

Our consulting service via telephone is available at no cost to you for as long as you own the home. Please visit our website and feel free to fill out and return our client questionnaire.

Thanks again for allowing us to work with you.

Sincerely,

Sina Zaman on behalf of Canspec Building Services

> Canspec Building Services 2984 Range Line Rd Ajax, ON L1S 6V9 1877-226-7732 4169932954 www.canspechome.com jamescan@rogers.com

EXECUTIVE SUMMARY

125 Maria Street, Toronto, ON January 20, 2025

www.canspechome.com

EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX									

This Summary outlines potentially significant issues from a cost or safety standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document. <u>Priority Maintenance Items</u>

Roofing

SLOPED ROOFING \ Asphalt shingles

Condition: • <u>Missing, loose or torn</u> Implication(s): Chance of water damage to structure, finishes and contents Task: Repair

SLOPED ROOF FLASHINGS \ Roof/wall flashings

Condition: • <u>Damage, loose, open seams, patched</u> Implication(s): Chance of water damage to structure, finishes and contents Task: Correct

FLAT ROOF FLASHINGS \ General notes

Condition: • Missing Task: Provide

Exterior

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Handrails and guards

Condition: • <u>Missing</u> Implication(s): Fall hazard Task: Provide

BASEMENT WALKOUTS \ General notes

Condition: • <u>Guard and handrail problems</u> Implication(s): Fall hazard Task: Correct

Electrical

SERVICE BOX, GROUNDING AND PANEL \ Distribution fuses/breakers

Condition: • <u>Double taps</u> Implication(s): Fire hazard Task: Correct

DISTRIBUTION SYSTEM \ Outlets (receptacles)

Condition: • Ungrounded Implication(s): Electric shock Location: Couple of outlets on second floor Task: correct

EXECUTIVE SUMMARY

125 Maria Street, Toronto, ON January 20, 2025

INTERIOR

www.canspechome.com

EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING

APPENDIX

Heating

CHIMNEY AND VENT \ Masonry chimney cap (crown)

Condition: • Missing

Implication(s): Chance of water damage to structure, finishes and contents | Shortened life expectancy of material **Task**: Provide

Interior

RECOMMENDATIONS \ General

Condition: • Unit is candidate for complete remodeling.

POTENTIALLY HAZARDOUS MATERIALS \ General notes

Condition: • Mold Implication(s): Health hazard Location: Basement Task: Further evaluation Clean

Overall this home requires improvement, for a home of this age and style of building. This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

Home Improvement - ballpark costs

Report No. 5961

 125 Maria Street, Toronto, ON January 20, 2025
 www.canspechome.com

 executive s
 ROOFING
 EXECUTIVE

 executive s
 ROOFING
 EXECUTIVE

APPENDIX

Description

Sloped roofing material:

<u>Asphalt shingles</u>



1. Asphalt shingles



3. Asphalt shingles



5. Asphalt shingles



2. Asphalt shingles



4. Asphalt shingles



6. Asphalt shingles

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S	R
EXECUTIVE 5	R

ROOFING

STRUCTURE ELECTRICAL

www.canspechome.com

PLUMBING

APPENDIX



7. Asphalt shingles



9. Asphalt shingles



11. Asphalt shingles



8. Asphalt shingles



10. Asphalt shingles



12. Asphalt shingles

Report No. 5961

www.canspechome.com

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S ROOFING	G EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION

ULATION PLUMBING

INTERIOR

APPENDIX



13. Asphalt shingles



15. Asphalt shingles



17. Asphalt shingles



14. Asphalt shingles



16. Asphalt shingles



18. Asphalt shingles

Report No. 5961

www.canspechome.com

PLUMBING

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S	ROO

FING

STRUCTURE ELECTRICAL

APPENDIX





19. Asphalt shingles

20. Asphalt shingles



21. Asphalt shingles

Flat roofing material: • Modified bitumen membrane Probability of leakage: • Medium

Approximate age: • 15-20 years

Typical life expectancy: • 20-25 years

Limitations

Inspection limited/prevented by:
 Snow/ice/frost

Inspection performed: • With a drone

Age determined by: • Drone

Not included as part of a building inspection: • Antennas • Not readily accessible interiors of vent systems, flues, and chimneys

ì
Ì

www.canspechome.com

PLUMBING

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S	ROOFING
-------------	---------

APPENDIX

Recommendations

SLOPED ROOFING \ Asphalt shingles

1. Condition: • Missing, loose or torn

Implication(s): Chance of water damage to structure, finishes and contents

STRUCTURE ELECTRICAL

Task: Repair



22. Missing, loose or torn

- 2. Condition: Tune up needed
- **3. Condition:** Tree branches close to roof **Task**: Remove

SLOPED ROOF FLASHINGS \ Roof/wall flashings

4. Condition: • Damage, loose, open seams, patched
 Implication(s): Chance of water damage to structure, finishes and contents
 Task: Correct



24. Damage, loose, open seams, patched

FLAT ROOF FLASHINGS \ General notes

5. Condition: • Missing Task: Provide



23. Missing, loose or torn

Report No. 5961

www.canspechome.com

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
---------------------	----------	-----------	------------	---------	---------	------------	----------	----------

APPENDIX



26. Missing

25. Missing

EXTERIOR

125 Maria Street, Toror	nto, ON Ja	anuary 20, 20	25				www.canspe	echome.com
EXECUTIVE S ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX								
Description								
Gutter & downspout n	naterial: • <u>A</u>	<u>luminum</u>						
Gutter & downspout t	ype: • <u>Eave</u>	mounted						
Gutter & downspout d	lischarge: •	Above grad	<u>e</u>					
Downspout discharge	: • <u>Above g</u> r	<u>rade</u>						
Lot slope: • Flat								
Soffit (underside of ea	aves) and fa	scia (front e	dge of eave	s): • <u>Wood</u>	• <u>Aluminum</u>			
Wall surfaces and trin	n: • <u>Metal si</u>	ding • Brick						
Wall surfaces - masor	ıry: • <u>Brick</u>							
Driveway: • Gravel								
Walkway: • Concrete								
Porch: • Wood								

Limitations

Inspection limited/prevented by: • Snow / ice / frost

No or limited access to: • Area below steps, deck, porches

Upper floors inspected from: • Ground level

Exterior inspected from: • Ground level

Not included as part of a building inspection: • Underground components (e.g., oil tanks, septic fields, underground drainage systems) • Screens, shutters, awnings, and similar seasonal accessories • Fences and boundary walls • Geological and soil conditions • Recreational facilities • Outbuildings other than garages and carports • Seawalls, breakwalls, docks • Erosion control, earth stabilization measures

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

RECOMMENDATIONS \ General

6. Condition: • Improve siding wall flashings. window trims. wood soffits

www.canspechome.com

PLUMBING

January 20, 2025 125 Maria Street, Toronto, ON

EXECUTIVE S	RO

APPENDIX





27.

28.



29.

7. Condition: • No Guardrail, handrail on flat room. Task: Provide



30.

EXTERIOR

www.canspechome.com

PLUMBING

INSULATION

125 Maria Street, Toronto, ON January 20, 2025

EXTERIOR

APPENDIX

ROOF DRAINAGE \ Gutters

8. Condition: • Dirty/debris

Task: Clean


ROOF DRAINAGE \ Downspouts

9. Condition: • Discharge onto roofs

Implication(s): Chance of water damage to structure, finishes and contents

STRUCTURE ELECTRICAL

Task: Correct

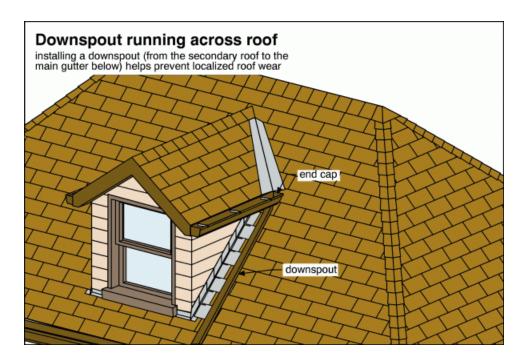



31. *Discharge onto roofs*

WALLS \ Masonry (brick, stone) and concrete

10. Condition: • <u>Masonry deterioration</u>Implication(s): Weakened structure | Chance of structural movementTask: Repair

	-	t No. 5961 echome.com
125 Maria Street, Toronto, ON January 20, 2025 EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION	PLUMBING	INTERIOR
APPENDIX	PLOMBING	INTERIOR
11. Condition: • Prior repairs		
Task: Monitor Time: Ongoing		

32. Prior repairs

EXTERIOR GLASS/WINDOWS \ General notes

12. Condition: • Too close to grade

Task: Improve Monitor



33. Too close to grade

13. Condition: • Improve caulking and sealing around the windows.

EXTERIOR GLASS/WINDOWS \ Exterior trim

14. Condition: • Rot

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration Task: Repair or replace

15. Condition: • Caulking loose, missing or deteriorated

Implication(s): Chance of water damage to structure, finishes and contents | Increased heating and cooling costs Task: Improve

Time: Regular maintenance

16. Condition: • Paint or stain neededImplication(s): Chance of water damage to structure, finishes and contents | Material deterioration

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Columns / Posts

17. Condition: • crack Task: improve, monitor

EXTERIOR

125 Maria Street, Toronto, ON January 20, 2025

		_							
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR









PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Floors

18. Condition: • Rot or insect damage

Implication(s): Weakened structure | Chance of movement | Material deterioration Task: Repair or replace



35. Rot or insect damage

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Stairs and landings

19. Condition: • Rot or insect damage Implication(s): Weakened structure | Material deterioration Location: Rear Task: Repair or replace



36. Rot or insect damage

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Handrails and guards

20. Condition: • Missing Implication(s): Fall hazard Report No. 5961

www.canspechome.com

EXTERIOR 125 Maria Street, Toronto, ON January 20, 2025	Report No. 5961 www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOL	
APPENDIX	
Task: Provide	
Handrails and guards	



37. Missing


BASEMENT WALKOUTS \ General notes 21. Condition: • Guard and handrail problems Implication(s): Fall hazard Task: Correct



38. Missing

EXTERIOR



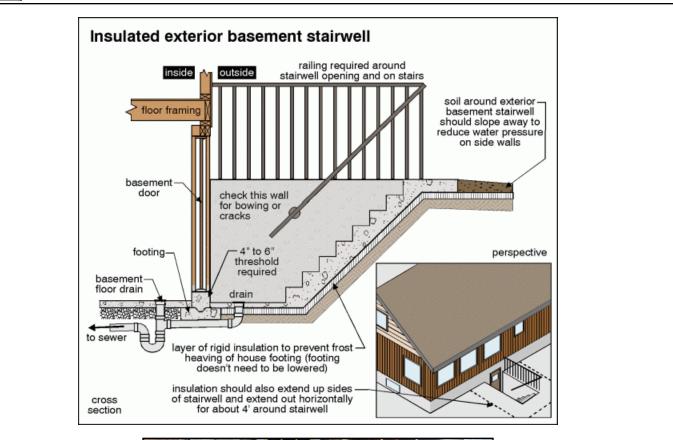




39. Guard and handrail problems

22. Condition: • Door threshold missing, too low, not watertightImplication(s): Chance of water damage to structure, finishes and contentsTask: Improve

Report No. 5961

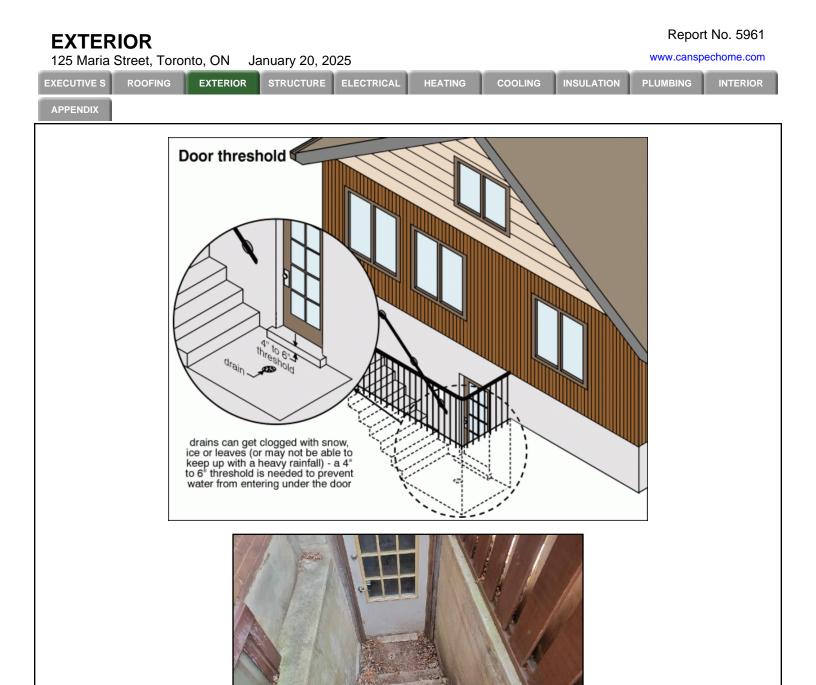

40. Door threshold missing, too low, not...

STRUCTURE

Report No. 5961

125 Maria Street, Toronto, ON January 20, 2025



www.canspechome.com

EXECUTIVE S

Description

Configuration:

Basement

ROOFING

Foundation material: • Stone • Brick

Floor construction: • Joists • Masonry columns • Wood beams (girders)

STRUCTURE ELECTRICAL

Exterior wall construction: • Masonry

Roof and ceiling framing:

Rafters

Only Small portion of attic is accessible



41. Rafters



42. Rafters

STRUCTURE 125 Maria Street, Toronto, ON January 20, 2025	Report No. 5961 www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING COOLING INSULATION PLUMBING INTERIOR
APPENDIX	
AAA <	<image/>
Plank sheathing	
Party wall: • Masonry	
Limitations	

Attic/roof space:
 Inspected from access hatch

Percent of foundation not visible: • 95 %

Not included as part of a building inspection: • Visible mold evaluation is not included in the building inspection report • An opinion about the adequacy of structural components • Less than 24 inches of vertical clearance cannot be entered in under-floor crawlspace areas • Access opening smaller than 16 inches x 24 inches cannot be entered in under-floor crawlspace areas • Attic load bearing components concealed by insulation cannot be traversed

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

RECOMMENDATIONS \ General

23. Condition: • Slope at stairs and floors. Typical for houses at this age Task: Improve

FOUNDATIONS \ Columns or piers

24. Condition: • Spalling concrete or brick Implication(s): Weakened structure | Chance of structural movement

STRUCTURE

Report No. 5961

www.canspechome.com

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S	

ROOFING

EXTERIOR STRUCTURE ELECTRICAL

APPENDIX

Task: Repair Improve



45. Spalling concrete or brick

FOUNDATIONS \ General notes

25. Condition: • Typical minor cracks Implication(s): Chance of water entering building

FOUNDATIONS \ Beams (Girders)

26. Condition: • Need improvement

ELECTRICAL 125 Maria Street, Toronto, ON January 20, 2025	Report No. 5961 www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION	I PLUMBING INTERIOR
Description	
<section-header></section-header>	
46. 200 Amps (240 Volts)	
Main disconnect/service box rating: • <u>200 Amps</u>	
Main disconnect/service box type and location: • Breakers - basement	

System grounding material and type:
• Copper - water pipe

Auxiliary panel (subpanel) type and location:

Breakers - basement

ELECTRICAL

Report No. 5961

125 Maria Street, Toronto, ON	January 20, 2025
-------------------------------	------------------

125 Maria Street, Toronto, ON January 20, 2025									www.canspechome.com		
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR		
APPENDIX											

Breakers - first floor





48. Breakers - first floor

Distribution wire (conductor) material and type: • Copper - non-metallic sheathed

ELECTRICAL

125 Maria Street, Toronto, ON January 20, 2025

STRUCTURE ELECTRICAL

COOLING

www.canspechome.com PLUMBING

EXECUTIVE S APPENDIX

Type and number of outlets (receptacles): • Grounded - typical • Ungrounded - minimal

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • GFCI - kitchen

Smoke alarms (detectors): • Present

ROOFING

Carbon monoxide (CO) alarms (detectors): • Present

Limitations

Panel covers: • Not safe to remove • Disconnect covers are not removed by the building inspector

System ground: • Continuity not verified

Panel or disconnect cover: • Not safe to remove

Not included as part of a building inspection: • Remote control devices • Low voltage wiring systems and components Testing of smoke and/or carbon monoxide alarms • Solar, wind, and other renewable energy systems • Amperage, voltage, and impedance measurements • Determination of the age of smoke and carbon monoxide alarms

Recommendations

RECOMMENDATIONS \ General


27. Condition: • Electrical need to be inspected by certified electrician. Time: When remodeling

SERVICE BOX, GROUNDING AND PANEL \ Distribution fuses/breakers

28. Condition: • Double taps Implication(s): Fire hazard Task: Correct

ELECTRICAL 125 Maria Street, Toronto, ON January 20, 2025



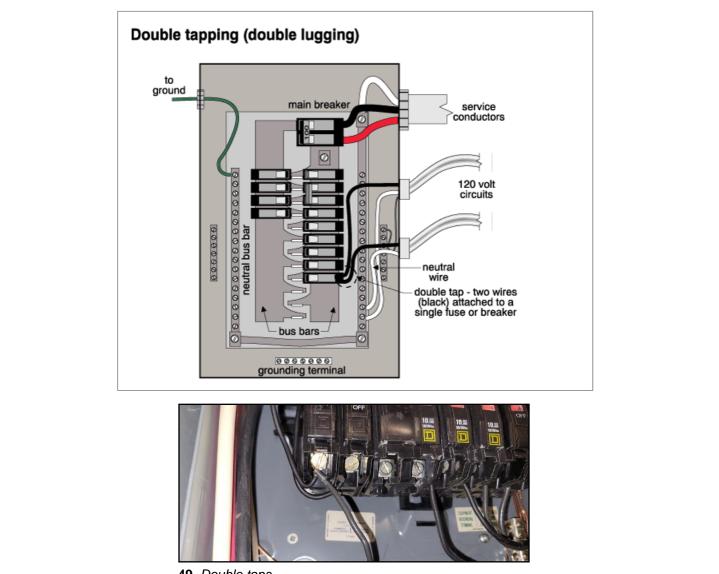

49. Double taps

SERVICE BOX, GROUNDING AND PANEL \ Auxiliary panel (subpanel)

29. Condition: • Too close to main panel **Task**: Improve

Report No. 5961

ELECTRICAL

Report No. 5961

www.canspechome.com

,	,	, , , , , , , , , , , , , , , , , , , _									
ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR			
Isr FooR.											
			ROOFING EXTERIOR STRUCTURE		ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING	ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING	ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION	ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING			





DISTRIBUTION SYSTEM \ Outlets (receptacles)

30. Condition: • <u>Ungrounded</u>
Implication(s): Electric shock
Location: Couple of outlets on second floor
Task: correct



51. Ungrounded

31. Condition: • Missing


Location: second floor (small bedroom or storage room Task: provide

ELECTRICAL			Report No. 5961
125 Maria Street, Toronto, ON January 20,	2025		www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTUR	E ELECTRICAL HEATING	COOLING INSULATIO	N PLUMBING INTERIOR
APPENDIX			
	<image/> <image/>		

DISTRIBUTION SYSTEM \ Smoke alarms (detectors)

32. Condition: • ADD SMOKE AND CO COMBINATION UNITS ON ALL FLOORS!!

33. Condition: • Test Regularly

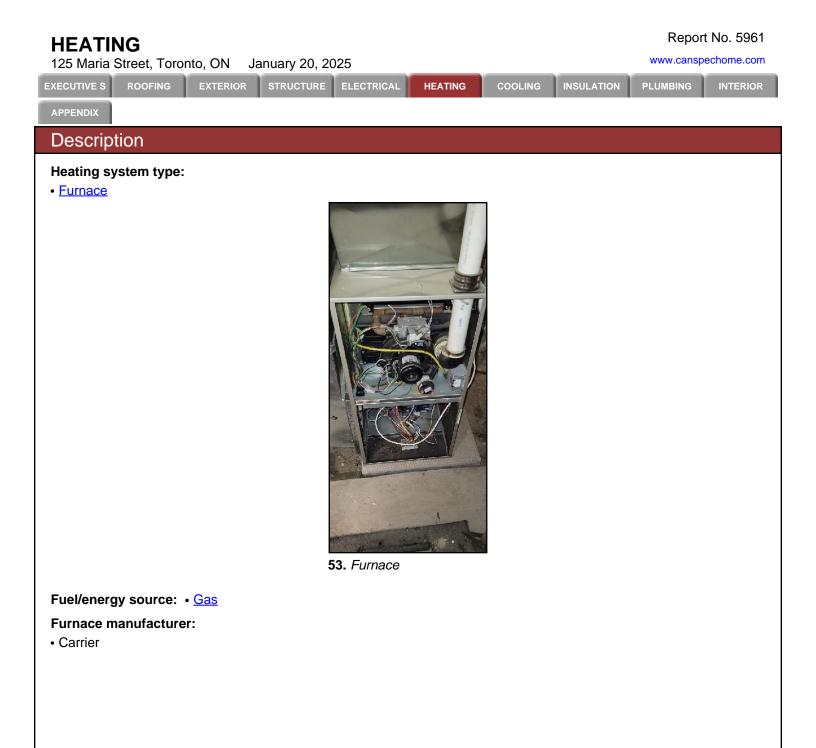

HEATING

Report No. 5961

www.canspechome.com

125 Maria Street, Toronto, ON January 20, 2025

The mana officer, referred, on bandary 20, 2020											
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR		
APPENDIX											
				ICUL INTERNALI	58234						
				det Rumber SATTFSABBE (1712)8 Schwar SattFSABBE (1712)8 T201 West Morris (0) T201 West Morris (0) Indianapuls, 1N 452 Frid Rumber A11045156							
			e2	OUCTIPRODULT BUT PRACEDET 71216	- titlet is						

54. Carrier

CERTIFIED

Heat distribution: • Ducts and registers

Approximate capacity:
 • <u>80,000 BTU/hr</u>

Efficiency: • High-efficiency

Exhaust venting method: • Induced draft

Combustion air source: • Outside

Approximate age: • 7 years

Typical life expectancy: • Furnace (high efficiency) 15 to 20 years

Main fuel shut off at: • Meter

Failure probability: • Low

Chimney/vent: • Masonry

Chimney liner: • Metal • Not visible

Humidifier: • Duct mounted bypass humidifer

Mechanical ventilation system for building: • Kitchen exhaust fan

HEATING Report No. 59									t No. 5961
125 Maria	Street, Toro	nto, ON Ja	anuary 20, 20	025				www.cansp	bechome.com
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR

APPENDIX

Limitations

Safety devices: • Not tested as part of a building inspection

Heat loss calculations: • Not done as part of a building inspection


Heat exchanger: • Not visible


Not included as part of a building inspection: • Heat loss calculations • Interiors of vent systems, flues, and chimneys • Heat exchangers • Humidifiers and dehumidifiers • Electronic air cleaners • Heating systems using ground source, water source, solar, and renewable energy technology • Heat/energy recovery systems • Whole house mechanical ventilation systems • Fireplace screens and doors • Fireplace seals and gaskets • Automatic fuel feed devices • Mantles and fireplace surrounds

Recommendations

CHIMNEY AND VENT \ Masonry chimney

34. Condition: • <u>Loose, missing or deteriorated masonry</u> **Implication(s)**: Material deterioration **Task**: Repair

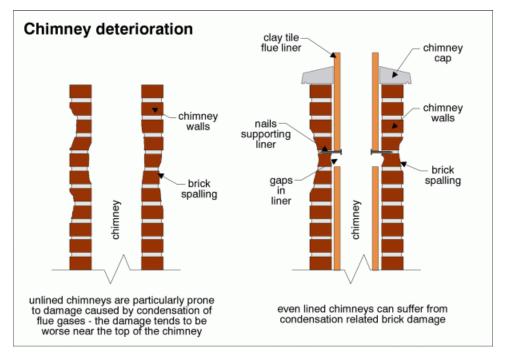


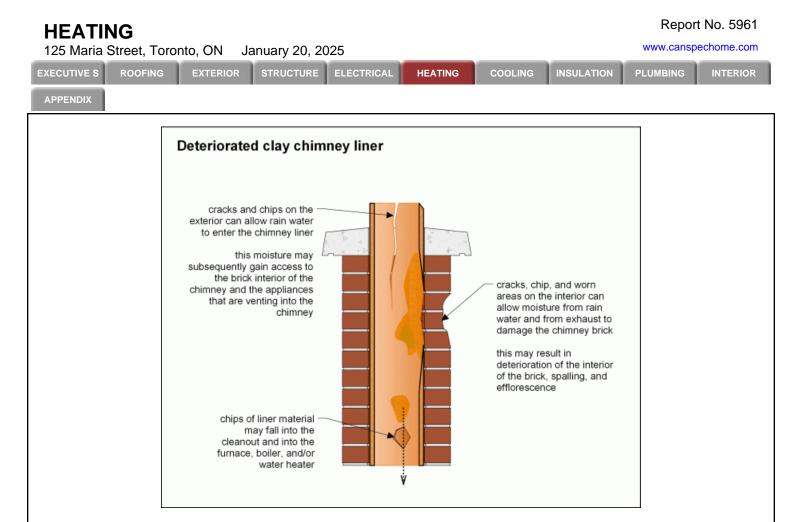

CHIMNEY AND VENT \ Masonry chimney cap (crown)

35. Condition: • Missing

Implication(s): Chance of water damage to structure, finishes and contents | Shortened life expectancy of material **Task**: Provide

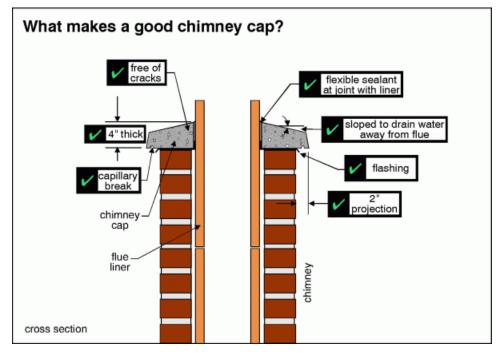

Peace of mind, one building at a time

HEATING

Report No. 5961

www.canspechome.com

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX									



55. Missing

COOLING & HEAT PUMP

www.canspechome.com

125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX								
Description								
Air conditioning type: None present								

Limitations

Window unit: • Window A/C excluded from inspection

Not included as part of a building inspection: • Electronic air cleaners • Cooling system adequacy • Cooling system distribution balance • Window cooling system • Ground source, water source, solar, and renewable energy technology • Heat gain or heat loss calculations

INSULATION AND VENTILATION

125 Maria Street, Toronto, ON January 20, 2025

www.canspechome.com

1	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING
---	----------	-----------	------------	---------	---------

INSULATION PLUMBING

APPENDIX

EXECUTIVE S

Description

Attic/roof insulation material: • Not determined • Not visible

Attic/roof insulation amount/value: • Not determined • Not visible

Attic/roof air/vapor barrier: • Not visible

ROOFING

Attic/roof ventilation: • Roof and soffit vents

Mechanical ventilation system for building: • Kitchen exhaust fan

Limitations

Attic inspection performed: • From access hatch

Air/vapor barrier system: • Continuity not verified

Mechanical ventilation effectiveness: • Not verified

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

ATTIC/ROOF \ Insulation

36. Condition: • Gaps or voids Implication(s): Increased heating and cooling costs | Reduced comfort Task: Improve



56. Gaps or voids

PLUMBING 125 Maria Street, Toronto, ON January 20, 2025	Report No. 5961 www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULAT	TION PLUMBING INTERIOR
Description	
Service piping into building: • <u>Copper</u>	
Supply piping in building: • <u>Copper</u>	
Main water shut off valve at the: • Basement	
Fr. Basement	
Water flow and pressure: • Functional	
Water heater type: • Tank	
Water heater location: Basement	
Water heater fuel/energy source: • Gas	
Water heater manufacturer: • Giant	



58. Giant

PLUMBING	Report	Report No. 5961	
125 Maria Street, Toronto, ON January 20, 2025	www.canspechome.com		
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION	PLUMBING	INTERIOR	
APPENDIX			
Water heater tank capacity: • 50 gallons			
Water heater approximate age: • 7 years			
Water heater typical life expectancy: • 10 to 15 years			
Waste disposal system: • Public			
Waste and vent piping in building: • ABS plastic • Cast iron			
Floor drain location: • Washroom			
Main gas shut off valve location: • Gas meter			
Exterior hose bibb (outdoor faucet): • Present			

Limitations

Items excluded from a building inspection: • Well • Water quality • Septic system • Isolating/relief valves & m ain shut-off valve • Concealed plumbing • Tub/sink overflows • Water treatment equipment • Water heater relief valves are not tested • The performance of floor drains or clothes washing machine drains • Pool • Spa • Water features • Landscape irrigation system • Pond • Hot tub • Sprinkler system

Not included as part of a building inspection: • Washing machine connections • Not readily accessible interiors of vent systems, flues, and chimneys • Wells, well pumps, and water storage related equipment • Water conditioning systems • Solar water heating systems • Geothermal water heating systems • Fire extinguishers and sprinkler systems • Landscape irrigation systems

Recommendations

RECOMMENDATIONS \ General

37. Condition: • Plumbing needs to be inspected by certified plumber. **Time**: When remodeling

SUPPLY PLUMBING \ Water service pipe

38. Condition: • Upgrade to steel braided hose on washing machine. May help avoid leaks due to rupture of hose.

WASTE PLUMBING \ Drain piping - performance

39. Condition: • Old Rust.Visible in basement.Task: Replace

PLUMBING

Report No. 5961

www.canspechome.com

125 Maria Street, Toronto, ON January 20, 2025

·									
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX									
			E	1000		5			
				X					

59. Old

Peace of mind, one building at a time

INTER	INTERIOR Report No. 5961									
125 Maria Street, Toronto, ON January 20, 2025 www.canspechome.co								echome.com		
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	
APPENDIX										

Description

General:

• Moisture meter results

No moisture detected during inspection.



60. Moisture meter results



62. Moisture meter results



61. Moisture meter results




63. Moisture meter results

INTERIOR 125 Maria Street, Toronto, ON January 20, 2025	Report No. 5961 www.canspechome.com					
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING COOLING INSULATION PLUMBING INTERIOR					
APPENDIX						
64. Moisture meter results	65. Moisture meter results					

64. Moisture meter results

General: • Infrared photos.

No signs of moisture on the ceiling during inspection.

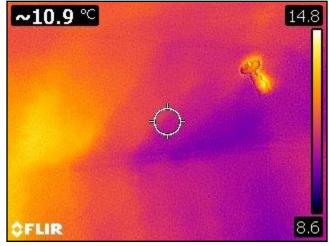

66.



INTERIOR 125 Maria Street, Toronto, ON January 20, 2025 EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING APPENDIX	Report No. 5961 www.canspechome.com COOLING INSULATION PLUMBING INTERIOR
12.8 °C 16.1 - - - - - 0.0 68.	
69. 11.6°C 14.6 C C C C C C C C	
► 17.7 °C 20.8	


14.6

72.

Page 38 of 60

Report No. 5961 **INTERIOR** www.canspechome.com 125 Maria Street, Toronto, ON January 20, 2025 EXECUTIVE S ROOFING STRUCTURE ELECTRICAL HEATING INSULATION PLUMBING INTERIOR APPENDIX 73. **~17.3** ℃ 20.8



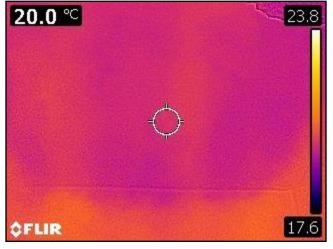




75.

Report No. 5961 www.canspechome.com

INTERIOR


125 Maria Street, Toronto, ON January 20, 2025

EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	

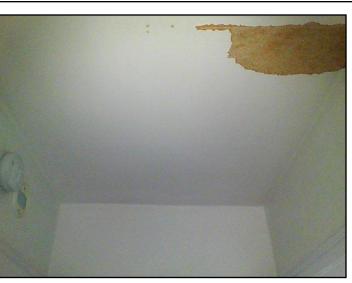




78.

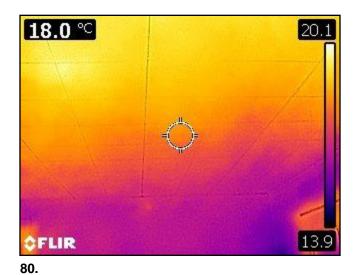




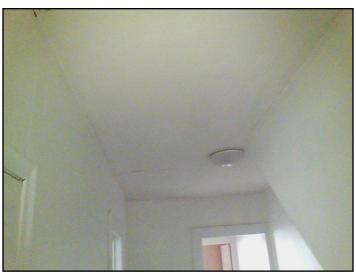

79.

INTERIOR				Repor	t No. 5961	
125 Maria Street, Toronto, ON January 20, 2025			www.canspechome.com			
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	
APPENDIX						
	81.				1	

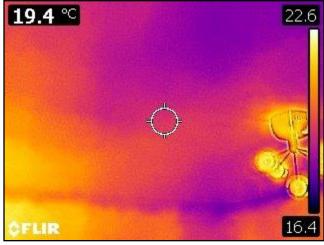

82.



83.

Major floor finishes: • Laminate Major wall and ceiling finishes: • Plaster/drywall Windows: • Fixed • Single/double hung Glazing: • Single • Double Evidence of basement leakage: • Efflorescence • Mold

INTERI		Repor	t No. 5961						
125 Maria Street, Toronto, ON January 20, 2025 www.canspecto									echome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING							PLUMBING	INTERIOR	

APPENDIX Limitations

Inspection limited/prevented by: • Storage/furnishings • Storage in closets and cabinets / cupboards

Not included as part of a building inspection: • Carbon monoxide alarms (detectors), security systems, central vacuum Carbon monoxide alarms (detectors) • Security systems and intercoms • Central vacuum systems • Cosmetic issues • Appliances • Perimeter drainage tile around foundation, if any • Decorative items • Aesthetics or quality of finishes • Vermin, including wood destroying organisms. • Underground components (e.g., oil tanks, septic fields, underground drainage systems) • Environmental issues including asbestos • Paint, wallpaper,and other finishes • Floor coverings • Window treatments • Window coatings and seals between panes of glass • Refrigeration for wine cellar • Sound systems

Appliances: • Appliances are not inspected as part of a building inspection

Percent of foundation not visible: • 95 %

Basement leakage: • Cannot predict how often or how badly basement will leak • Storage in basement limited inspection

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

Recommendations

RECOMMENDATIONS \ General 40. Condition: • Unit is candidate for complete remodeling.

WINDOWS AND DOORS \ General notes 41. Condition: • Old

Task: Replace

POTENTIALLY HAZARDOUS MATERIALS \ General notes

42. Condition: • Mold
Implication(s): Health hazard
Location: Basement
Task: Further evaluation Clean

INTERIOR	
125 Maria Street, Toronto, ON	January 20, 2025





84. Mold



INSULATION

85. Mold



HEATING

86. Mold

END OF REPORT

Report No. 5961

INTERIOR

www.canspechome.com

PLUMBING

APPENDIX	Report No. 5961
125 Maria Street, Toronto, ON January 20, 2025	www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INS	SULATION PLUMBING INTERIOR
APPENDIX	
Implications of issues not corrected after inspection	
*Failure to correct issues contained in the report <u>may</u> lead to the follo	owing
implications.	
Moisture infiltration Can be caused by issues related to, poor water managem	ient, around the
home, gutter plumbing, roof, foundation, window or door and building cladding	
problems. Failure to correct issues may result in water damage (including mold),	
and material deterioration/ damage to building assemblies, finishes and or Struc	sture.
Structural movement or deterioration can be caused by ongoing moisture issue	-
deterioration, compromised components (Amateur building work), inadequate s	
even seismic disturbances. Failure to correct issues may result in structural move eventual catastrophic structural failure.	ement and
Electrical issues can be caused by deterioration of existing components or the a	
standard components and or workmanship. Failure to correct issues may result shock and or fire hazard.	
<u>Plumbing issues</u> can be caused by deterioration of existing components or the a standard components and or workmanship. Failure to correct issues may result	
damage to contents and material deterioration/ damage to building assemblies,	
structure.	
Fall Hazards Falls can be the result of underbuilt or incorrectly built; stair, landi	ng or deck
components, railings, guards, or stairs. Steps should be consistent and any sharp	-
flooring material should be reduced for safety. Failure to correct any potential fa	all hazard may
result in injury.	
Insurance implications Insurers may have any number of components that they	r consider an
insurance risk. Most Insurers will survey the homebuyer to determine the type of	•
installed in the home. The following is a list of the most prominent insurance iss	
companies may not insure a home until a certain standard is met, or they may cl premium to insure the home. <i>Galvanized steel distribution pipe, some types or</i>	-
plastic distribution pipe, Cast iron drain pipe, Knob and tube wire, Aluminum w	-
burning appliances.	···· · , ·····
* General Any issues documented on the home inspection report should be prioritize	ed and corrected.
When left to deteriorate any building material may fail, and may impact other part	
Potential issues may lead to actual issues that will require immediate attention. In mo	ost cases leaving a
component to deteriorate further will lead to higher cost of repair.	

	APPENDIX Report No. 5961 125 Maria Street, Toronto, ON January 20, 2025 www.canspechome.com									
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	
APPENDIX										
										Ì

APPENDIX			Report No. 5961
125 Maria Street, Toronto, ON	January 20, 2025		www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR	STRUCTURE ELECTRICAL	HEATING COOLING INSULATION	PLUMBING INTERIOR
APPENDIX			
The	The International Star Performing a Gener ar International Code of E	al Home Inspection This for Home Inspectors	
	Effective J	lune 2013	
	Peace of mind one	building at a time	Daga 46 of 60

Peace of mind, one building at a time

InterNACHI's Vision and Mission

InterNACHI, the International Association of Certified Home Inspectors, is <u>the world's largest organization of</u> <u>residential and commercial property inspectors.</u>

As a <u>federally tax-exempt</u>, 501(c)(6) non-profit, InterNACHI provides <u>training</u>, <u>certification</u>, and <u>Continuing Education</u> for its membership, including property inspectors, licensed real estate agents, and building contractors; and provides for its membership <u>business training</u>, <u>software</u> <u>products</u>, <u>marketing services</u>, and <u>membership benefits</u>.

InterNACHI members follow a comprehensive <u>Standards</u> of <u>Practice</u> and are bound by a strict <u>Code of Ethics</u>. The membership takes part in the regular exchange of professional experiences and ideas to support each other. InterNACHI maintains an <u>industry blog</u>, <u>Inspection</u> <u>Forum</u>, and <u>local Chapters</u> in support of this exchange of information. InterNACHI provides its members with other means of direct and membership-wide communication to further their understanding of their particular roles in the inspection industry and how best to serve their clients. The benefits of this cross-communication enhance the members' ability to build their businesses and develop specialized ancillary services.

In fulfilling this fundamental objective of training and mentoring its inspector-members, InterNACHI's broader mission is to educate homeowners by helping them understand the functions, materials, systems and components of their properties. InterNACHI inspectors are committed to providing consistent, accessible and trusted information to their clients about their properties' condition.

Headquarters:

International Association of Certified Home Inspectors (InterNACHI) 1750 30th Street Boulder, CO 80301 USA

(303) 502-6214 <u>fastreply@internachi.org</u> U.S. DUNS #015117501

To find an InterNACHI Certified Professional Inspector®, visit InspectorSeek.com.

Irrevocable Non-Exclusive License for Use by Government Entities

The International Association of Certified Home Inspectors (InterNACHI) hereby grants this irrevocable, non-exclusive, royalty-free license to any federal, state, or local government located in the United States or Canada, and any agencies thereof, including licensing boards, to use InterNACHI's Standards of Practice, Code of Ethics, and any other materials found on the InterNACHI website (www.nachi.org) free of charge, without the need for pre-approval, provided that each use is clearly attributed to InterNACHI.

InterNACHI specifically authorizes any government or government agency to use and copy, for any public purpose, InterNACHI's Standards of Practice, Code of Ethics, and other materials without further approval from InterNACHI, even if the materials are protected by copyright or other laws.

Available Online in English, Spanish and French

The International Standards of Practice for Performing a General Home Inspection is available online at http://www.nachi.org/sop.htm

The International Code of Ethics for Home Inspectors is available online at http://www.nachi.org/code_of_ethics.htm

Estándares de Práctica, the Spanish version of the International Standards of Practice for Performing a General Home Inspection, is available online at <u>http://www.nachi.org/sopspanish.htm</u>

Código de ética, the Spanish version of the International Code of Ethics for Home Inspectors, is available online at <u>http://www.nachi.org/coespanish.htm</u>

Les Normes de Pratique Internationales pour la Réalisation d'une Inspection Générale de Biens Immobiliers, the French version of the International Standards of Practice for Performing a General Home Inspection, is available online at http://www.nachi.org/res-sop-french.htm

Code de Déontologie de l'Inspection Immobilière, the French version of the International Code of Ethics for Home Inspectors, is available online at http://www.nachi.org/code-of-ethics-french.htm

APPEN	APPENDIX									
125 Maria Street, Toronto, ON January 20, 2025									www.canspechome.com	
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	

The International Standards of Practice for Performing a General Home Inspection							
TABLE OF CONTENTS							
1. Definitions and Scope 3							
2. Limitations, Exceptions & Exclusions 3							
3. Standards of Practice5							
3.1. Roof 5 3.2. Exterior 5 3.3. Basement, Foundation, Crawlspace & Structure 6 3.4. Heating 6 3.5. Cooling 7 3.6. Plumbing 7 3.7. Electrical 8 3.8. Fireplace 9 3.9. Attic, Insulation & Ventilation 10 3.10. Doors, Windows & Interior 11							
4. Glossary of Terms 12							
Code of Ethics 14							

1. Definitions and Scope

1.1. A general home inspection is a non-invasive, visual examination of the accessible areas of a residential property (as delineated below), performed for a fee, which is designed to identify defects within specific systems and components defined by these Standards that are both observed and deemed material by the inspector. The scope of work may be modified by the Client and Inspector prior to the inspection process.

- I. The general home inspection is based on the observations made on the date of the inspection, and not a prediction of future conditions.
- II. The general home inspection will not reveal every issue that exists or ever could exist, but only those material defects observed on the date of the inspection.

1.2. A **material defect** is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the value of the property, or that poses an unreasonable risk to people. The fact that a system or component is near, at, or beyond the

end of its normal, useful life is not, in itself, a material defect.

1.3. A general home inspection report shall identify, in written format, defects within specific systems and components defined by these Standards that are both observed and deemed material by the inspector. Inspection reports may include additional comments and recommendations.

2. Limitations, Exceptions & Exclusions

2.1. Limitations:

- I. An inspection is not technically exhaustive.
- II. An inspection will not identify concealed or latent defects.
- An inspection will not deal with aesthetic concerns or what could be deemed matters of taste, cosmetic defects, etc.
- IV. An inspection will not determine the suitability of the property for any use.
- V. An inspection does not determine the market value of the property or its marketability.
- VI. An inspection does not determine the insurability of the property.
- VII. An inspection does not determine the advisability or inadvisability of the purchase of the inspected property.
- VIII. An inspection does not determine the life expectancy of the property or any components or systems therein.
- IX. An inspection does not include items not permanently installed.
- X. This Standards of Practice applies only to properties with four or fewer residential units and their attached garages and carports.

2.2. Exclusions:

I. The inspector is not required to determine:

- A. property boundary lines or encroachments.
- B. the condition of any component or system that is not readily accessible.
- C. the service life expectancy of any component or system.
- D. the size, capacity, BTU, performance or efficiency of any component or system.
- E. the cause or reason of any condition.
- F. the cause for the need of correction, repair or replacement of any system or component.
- G. future conditions.
- H. compliance with codes or regulations.

APPENDIA 125 Maria Stree				Report No. 5961 www.canspechome.com
	FING EXTERIOR STRUCTURE ELECTRICAL	HEATING	COOLING INSULATION	PLUMBING INTERIOR
APPENDIX				
	InterNACHI's International Standards of Pract	ice for Perfi	ormina a General Home Inspection	
Ι.	the presence of evidence of rodents, birds,		debris, snow, water, dirt, pets, or a	outhing else
	animals, insects, or other pests. the presence of mold, mildew or fungus.		that might restrict the visual inspect	, ,
	the presence of airborne hazards, including radon.	В.	dismantle, open or uncover any sys component.	stem or
	the air quality. the existence of environmental hazards,	C.	enter or access any area that may,	in the
N.	including lead paint, asbestos or toxic drywall. the existence of electromagnetic fields.	D.	inspector's opinion, be unsafe. enter crawlspaces or other areas th	nat may be
	any hazardous waste conditions. any manufacturers' recalls or conformance with		unsafe or not readily accessible.	
	manufacturer installation, or any information included for consumer protection purposes.	E.	inspect underground items, such as limited to: lawn-irrigation systems, of	
	acoustical properties. correction, replacement or repair cost		underground storage tanks (or india their presence), whether abandone	
S.	estimates. estimates of the cost to operate any given	F	used. do anything that may, in the inspec	tor's opinion
ll The	system. inspector is not required to operate:	г.	be unsafe or dangerous to him/hers or damage property, such as, but n	self or others,
	any system that is shut down.		walking on roof surfaces, climbing l entering attic spaces, or negotiating	adders,
B.	any system that does not function properly.	G.	inspect decorative items.	g with pero.
C.	or evaluate low-voltage electrical systems, such as, but not limited to:	H.	inspect common elements or areas housing.	in multi-unit
	1. phone lines; 2. cable lines;	I.	inspect intercoms, speaker systems	s or security
	3. satellite dishes; 4. antennae;	J.	offer guarantees or warranties.	
	 5. lights; or 6. remote controls. 	К.	offer or perform any engineering se	ervices.
D.	any system that does not turn on with the use of normal operating controls.	L.	offer or perform any trade or profes service other than general home in	
E.	any shut-off valves or manual stop valves.	М.	research the history of the property its potential for alteration, modificat	
F.	any electrical disconnect or over-current protection devices.		extendibility or suitability for a spec proposed use for occupancy.	ific or
G.	any alarm systems.	N.	determine the age of construction of any system, structure or comport	
H.	moisture meters, gas detectors or similar equipment.		building, or differentiate between or construction and subsequent additi improvements, renovations or repla	riginal ons,
III. The	e inspector is not required to:	О.	determine the insurability of a prop	
A.	move any personal items or other obstructions, such as, but not limited to: throw rugs, carpeting, wall coverings, furniture, ceiling tiles, window coverings, equipment, plants, ice,		perform or offer Phase 1 or environ audits.	-
		4		

APPENDIX	Report No. 5961 www.canspechome.com								
125 Maria Street, Toronto, ON January 20, 2025 EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL									
	HEATING COOLING INSULATION PLUMBING INTERIOR								
APPENDIX									
InterNACHI's International Standards of Prac	ctice for Performing a General Home Inspection								
Q. inspect any system or component that is not	I. perform a water test.								
included in these Standards.	J. warrant or certify the roof.								
3. Standards of Practice	K. confirm proper fastening or installation of any roof-covering material.								
3.1. Roof	3.2. Exterior								
I. The inspector shall inspect from ground level or the eaves:	I. The inspector shall inspect:								
A. the roof-covering materials;	 A. the exterior wall-covering materials, flashing and trim; 								
B. the gutters;	B. all exterior doors;								
C. the downspouts;	C. adjacent walkways and driveways;								
D. the vents, flashing, skylights, chimney, and other	D. stairs, steps, stoops, stairways and ramps;								
roof penetrations; and	E. porches, patios, decks, balconies and carports;								
 E. the general structure of the roof from the readily accessible panels, doors or stairs. 	F. railings, guards and handrails;								
II. The inspector shall describe:	G. the eaves, soffits and fascia;								
A. the type of roof-covering materials.	H. a representative number of windows; and								
III. The inspector shall report as in need of correction:	I. vegetation, surface drainage, retaining walls and								
A. observed indications of active roof leaks.	grading of the property, where they may adversely affect the structure due to moisture intrusion.								
IV. The inspector is not required to:	II. The inspector shall describe:								
A. walk on any roof surface.	•								
B. predict the service life expectancy.	A. the type of exterior wall-covering materials.								
C. inspect underground downspout diverter drainage pipes.	III. The inspector shall report as in need of correction:A. any improper spacing between intermediate								
 remove snow, ice, debris or other conditions that prohibit the observation of the roof surfaces. 	balusters, spindles and rails. IV. The inspector is not required to:								
E. move insulation.	 A. inspect or operate screens, storm windows, shutters, awnings, fences, outbuildings, or 								
 F. inspect antennae, satellite dishes, lightning arresters, de-icing equipment, or similar 	exterior accent lighting.								
attachments. G. walk on any roof areas that appear, in the	 B. inspect items that are not visible or readily accessible from the ground, including window and door flashing. 								
inspector's opinion, to be unsafe.	C. inspect or identify geological, geotechnical,								
 H. walk on any roof areas if doing so might, in the inspector's opinion, cause damage. 	hydrological or soil conditions.								
	5								

E

APPENDIX 125 Maria Street, Toronto, ON January 20, 2025	www.canspechome.com					
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING COOLING INSULATION PLUMBING INTERIOR					
APPENDIX						
InterNACHI's International Standards of Pract	tice for Performing a General Home Inspection					
 D. inspect recreational facilities or playground equipment. 	 observed indications of possible foundation movement, such as sheetrock cracks, brick cracks, out-of-square door frames, and unlevel 					
E. inspect seawalls, breakwalls or docks.	floors; and					
 F. inspect erosion-control or earth-stabilization measures. 	 D. any observed cutting, notching and boring of framing members that may, in the inspector's 					
G. inspect for safety-type glass.	opinion, present a structural or safety concern.					
H. inspect underground utilities.	IV. The inspector is not required to:					
I. inspect underground items.	 A. enter any crawlspace that is not readily accessible, or where entry could cause damage 					
J. inspect wells or springs.	or pose a hazard to him/herself.					
K. inspect solar, wind or geothermal systems.	B. move stored items or debris.					
L. inspect swimming pools or spas.	C. operate sump pumps with inaccessible floats.					
 M. inspect wastewater treatment systems, septic systems or cesspools. 	 identify the size, spacing, span or location or determine the adequacy of foundation bolting, bracing, joists, joist spans or support systems. 					
N. inspect irrigation or sprinkler systems.	E. provide any engineering or architectural service.					
O. inspect drainfields or dry wells.	F. report on the adequacy of any structural system					
P. determine the integrity of multiple-pane window glazing or thermal window seals.	or component.					
	3.4. Heating					
3.3. Basement, Foundation, Crawlspace & Structure	I. The inspector shall inspect:					
I. The inspector shall inspect: A. the foundation;	 A. the heating system, using normal operating controls. 					
B. the basement;	II. The inspector shall describe:					
C. the crawlspace; and	A. the location of the thermostat for the heating					
D. structural components.	system;					
II. The inspector shall describe:	B. the energy source; and					
A. the type of foundation; and	C. the heating method.					
B. the location of the access to the under-floor	III. The inspector shall report as in need of correction:					
space.	A. any heating system that did not operate; and					
III. The inspector shall report as in need of correction:	B. if the heating system was deemed inaccessible.					
 A. observed indications of wood in contact with or near soil; 	IV. The inspector is not required to:					
B. observed indications of active water penetration;	 A. inspect or evaluate the interior of flues or chimneys, fire chambers, heat exchangers, combustion air systems, fresh-air intakes, 					

ľ

APPENDIX								Report No. 5			
125 Maria	125 Maria Street, Toronto, ON January 20, 2025							www.cansp	echome.com		
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR		
APPENDIX											
InterNACHI's International Standards of Practice for Performing a General Home Inspection											
humidifiers, dehumidifiers, electronic air filters, geothermal systems, or solar heating systems.							es are not condu damage the equi				

- B. inspect fuel tanks or underground or concealed fuel supply systems.
- C. determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the heating system.
- D. light or ignite pilot flames.
- E. activate heating, heat pump systems, or other heating systems when ambient temperatures or other circumstances are not conducive to safe operation or may damage the equipment.
- F. override electronic thermostats.
- G. evaluate fuel quality.
- H. verify thermostat calibration, heat anticipation, or automatic setbacks, timers, programs or clocks.

3.5. Cooling

I. The inspector shall inspect:

- A. the cooling system, using normal operating controls.
- II. The inspector shall describe:
 - A. the location of the thermostat for the cooling system; and
 - B. the cooling method.
- III. The inspector shall report as in need of correction:
 - A. any cooling system that did not operate; and
 - B. if the cooling system was deemed inaccessible.
- IV. The inspector is not required to:
 - A. determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the cooling system.
 - B. inspect portable window units, through-wall units, or electronic air filters.
 - C. operate equipment or systems if the exterior temperature is below 65° Fahrenheit, or when

- D. inspect or determine thermostat calibration, cooling anticipation, or automatic setbacks or clocks.
- E. examine electrical current, coolant fluids or gases, or coolant leakage.

3.6. Plumbing

- I. The inspector shall inspect:
 - A. the main water supply shut-off valve;
 - B. the main fuel supply shut-off valve;
 - C. the water heating equipment, including the energy source, venting connections, temperature/pressure-relief (TPR) valves, Watts 210 valves, and seismic bracing;
 - D. interior water supply, including all fixtures and faucets, by running the water;
 - E. all toilets for proper operation by flushing;
 - F. all sinks, tubs and showers for functional drainage;
 - G. the drain, waste and vent system; and
 - H. drainage sump pumps with accessible floats.
- II. The inspector shall describe:
 - A. whether the water supply is public or private based upon observed evidence;
 - B. the location of the main water supply shut-off valve;
 - C. the location of the main fuel supply shut-off valve.
 - D. the location of any observed fuel-storage system; and
 - E. the capacity of the water heating equipment, if labeled.
- III. The inspector shall report as in need of correction:

APPENI 125 Maria S		, Toronto, ON January 20, 2025		Report No. 5961 www.canspechome.com
EXECUTIVE S	ROO		HEATIN	G COOLING INSULATION PLUMBING INTERIOR
APPENDIX				
		InterNACHI's International Standards of Pract	ice for Perf	forming a General Home Inspection
	Α.	deficiencies in the water supply by viewing the functional flow in two fixtures operated simultaneously;		evaluate fuel storage tanks or supply systems. inspect wastewater treatment systems.
	В.	deficiencies in the installation of hot and cold	О.	inspect water treatment systems or water filters.
	C.	water faucets; mechanical drain stops that were missing or did	Ρ.	inspect water storage tanks, pressure pumps, or bladder tanks.
	D.	not operate if installed in sinks, lavatories and tubs; and toilets that were damaged, had loose	Q.	evaluate wait time to obtain hot water at fixtures, or perform testing of any kind to water heater elements.
		connections to the floor, were leaking, or had tank components that did not operate.	R.	evaluate or determine the adequacy of combustion air.
IV		inspector is not required to: light or ignite pilot flames.	S.	test, operate, open or close: safety controls, manual stop valves, temperature/pressure-relief
		measure the capacity, temperature, age, life		valves, control valves, or check valves.
		expectancy or adequacy of the water heater. inspect the interior of flues or chimneys, combustion air systems, water softener or filtering systems, well pumps or tanks, safety	Т.	examine ancillary or auxiliary systems or components, such as, but not limited to, those related to solar water heating and hot water circulation.
		or shut-off valves, floor drains, lawn sprinkler systems, or fire sprinkler systems.		determine the existence or condition of polybutylene plumbing.
	D.	determine the exact flow rate, volume, pressure, temperature or adequacy of the water supply.	V.	inspect or test for gas or fuel leaks, or indications thereof.
	E.	determine the water quality, potability or reliability of the water supply or source.	3.7. El	ectrical
	F.	open sealed plumbing access panels.	I. The i	nspector shall inspect:
	G.	inspect clothes washing machines or their connections.	A.	the service drop;
	Н.	operate any valve.	В.	the overhead service conductors and attachment point;
	I.	test shower pans, tub and shower surrounds or enclosures for leakage or functional overflow protection.		the service head, gooseneck and drip loops;
	J.	evaluate the compliance with conservation,		the service mast, service conduit and raceway; the electric meter and base;
		energy or building standards, or the proper design or sizing of any water, waste or venting		service-entrance conductors;
	K.	components, fixtures or piping. determine the effectiveness of anti-siphon, back-	G.	the main service disconnect;
		flow prevention or drain-stop devices.	H.	panelboards and over-current protection devices (circuit breakers and fuses);
	L.	determine whether there are sufficient cleanouts for effective cleaning of drains.	I.	service grounding and bonding;
		٤	3	

APPENDIX 125 Maria Street, Toronto, ON January 20, 2025	Report No. 5961 www.canspechome.com
EXECUTIVE S ROOFING EXTERIOR STRUCTURE ELECTRICAL APPENDIX	HEATING COOLING INSULATION PLUMBING INTERIOR
InterNACHI's International Standards of Practic	ce for Performing a General Home Inspection
 J. a representative number of switches, lighting fixtures and receptacles, including receptacles observed and deemed to be arc-fault circuit interrupter (AFCI)-protected using the AFCI test button, where possible; 	 E. operate or test smoke or carbon-monoxide detectors or alarms F. inspect, operate or test any security, fire or alarms systems or components, or other warning or signaling systems.
 All ground-fault circuit interrupter receptacles and circuit breakers observed and deemed to be GFCIs using a GFCI tester, where possible; and 	 G. measure or determine the amperage or voltage of the main service equipment, if not visibly labeled.
L. smoke and carbon-monoxide detectors.	H. inspect ancillary wiring or remote-control
II. The inspector shall describe:	devices.
 A. the main service disconnect's amperage rating, if labeled; and 	 activate any electrical systems or branch circuits that are not energized.
B. the type of wiring observed.	 J. inspect low-voltage systems, electrical de-icing tapes, swimming pool wiring, or any time-
III. The inspector shall report as in need of correction:	controlled devices.
A. deficiencies in the integrity of the service- entrance conductors' insulation, drip loop, and	K. verify the service ground.
vertical clearances from grade and roofs; B. any unused circuit-breaker panel opening that was not filled;	 Inspect private or emergency electrical supply sources, including, but not limited to: generators, windmills, photovoltaic solar collectors, or battery or electrical storage facility.
 C. the presence of solid conductor aluminum branch-circuit wiring, if readily visible; 	M. inspect spark or lightning arrestors.
D. any tested receptacle in which power was not	N. inspect or test de-icing equipment.
present, polarity was incorrect, the cover was	O. conduct voltage-drop calculations.
not in place, the GFCI devices were not properly installed or did not operate properly, evidence of	P. determine the accuracy of labeling.
arcing or excessive heat, and where the receptacle was not grounded or was not secured to the wall; and	Q. inspect exterior lighting.
E. the absence of smoke detectors.	3.8. Fireplace
IV. The inspector is not required to:	I. The inspector shall inspect:
 A. insert any tool, probe or device into the main panelboard, sub-panels, distribution panelboards, or electrical fixtures. 	 readily accessible and visible portions of the fireplaces and chimneys;
 B. operate electrical systems that are shut down. 	B. lintels above the fireplace openings;
 C. remove panelboard cabinet covers or dead fronts. 	C. damper doors by opening and closing them, if readily accessible and manually operable; and
	D. cleanout doors and frames.
 D. operate or re-set over-current protection devices or overload devices. 	II. The inspector shall describe:
	A. the type of fireplace.
9	

		(t, Toronto, ON January 20, 2025		Report No. 5961 www.canspechome.com
EXECUTIVE S	_	FING EXTERIOR STRUCTURE ELECTRICAL	HEATING	
APPENDIX				
		InterNACHI's International Standards of Prac	ctice for Perf	orming a General Home Inspection
l	lll. The	e inspector shall report as in need of correction:	Ρ.	perform a Phase I fireplace and chimney inspection.
	A.	evidence of joint separation, damage or deterioration of the hearth, hearth extension or chambers;	3.9. At	tic, Insulation & Ventilation
	-		I. The i	inspector shall inspect:
	В.	manually operated dampers that did not open and close;	A.	insulation in unfinished spaces, including attics, crawlspaces and foundation areas;
	C.	the lack of a smoke detector in the same room as the fireplace;	В.	ventilation of unfinished spaces, including attics, crawlspaces and foundation areas; and
	D.	the lack of a carbon-monoxide detector in the same room as the fireplace; and	C.	mechanical exhaust systems in the kitchen, bathrooms and laundry area.
	E.	cleanouts not made of metal, pre-cast cement, or other non-combustible material.	II. The	inspector shall describe:
I	IV. The	e inspector is not required to:	Α.	the type of insulation observed; and
	A.	inspect the flue or vent system.	В.	the approximate average depth of insulation observed at the unfinished attic floor area or roof
	В.	inspect the interior of chimneys or flues, fire doors or screens, seals or gaskets, or mantels.		structure.
	C	determine the need for a chimney sweep.	III. The	inspector shall report as in need of correction:
		operate gas fireplace inserts.	Α.	the general absence of insulation or ventilation in unfinished spaces.
		light pilot flames.	IV. The	e inspector is not required to:
		determine the appropriateness of any installation.		enter the attic or any unfinished spaces that are not readily accessible, or where entry could
	G.	inspect automatic fuel-fed devices.		cause damage or, in the inspector's opinion, pose a safety hazard.
	Н.	inspect combustion and/or make-up air devices.	В.	move, touch or disturb insulation.
	I.	inspect heat-distribution assists, whether gravity- controlled or fan-assisted.	C.	move, touch or disturb vapor retarders.
	J.	ignite or extinguish fires.	D.	break or otherwise damage the surface finish or weather seal on or around access panels or
	K.	determine the adequacy of drafts or draft characteristics.	E.	covers. identify the composition or R-value of insulation
	L.	move fireplace inserts, stoves or firebox contents.	F.	material. activate thermostatically operated fans.
	M.	perform a smoke test.		determine the types of materials used in
	N.	dismantle or remove any component.		insulation or wrapping of pipes, ducts, jackets, boilers or wiring.
	0.	perform a National Fire Protection Association (NFPA)-style inspection.	H.	determine the adequacy of ventilation.
			10	

Street, Toronto, ON January 20, 2025	www.car
ROOFING EXTERIOR STRUCTURE ELECTRICAL	HEATING COOLING INSULATION PLUMBING
InterNACHI's International Standards of Practic 3.10. Doors, Windows & Interior	J. inspect or operate equipment housed in the
I. The inspector shall inspect:	garage, except as otherwise noted.
 A. a representative number of doors and windows by opening and closing them; 	 K. verify or certify the proper operation of any pressure-activated auto-reverse or related safe feature of a garage door.
B. floors, walls and ceilings;	L. operate or evaluate any security bar release an
C. stairs, steps, landings, stairways and ramps;	opening mechanisms, whether interior or exterior, including their compliance with local,
D. railings, guards and handrails; and	state or federal standards.
E. garage vehicle doors and the operation of garage vehicle door openers, using normal operating controls.	 M. operate any system, appliance or component that requires the use of special keys, codes, combinations or devices.
II. The inspector shall describe:	 N. operate or evaluate self-cleaning oven cycles, t guards/latches, or signal lights.
 A. a garage vehicle door as manually-operated or installed with a garage door opener. 	 O. inspect microwave ovens or test leakage from microwave ovens.
III. The inspector shall report as in need of correction:	P. operate or examine any sauna, steam-
 A. improper spacing between intermediate balusters, spindles and rails for steps, stairways, guards and railings; 	generating equipment, kiln, toaster, ice maker, coffee maker, can opener, bread warmer, blender, instant hot-water dispenser, or other small, ancillary appliances or devices.
 B. photo-electric safety sensors that did not operate properly; and 	Q. inspect elevators.
 C. any window that was obviously fogged or displayed other evidence of broken seals. 	R. inspect remote controls.
	S. inspect appliances.
IV. The inspector is not required to:	T. inspect items not permanently installed.
 A. inspect paint, wallpaper, window treatments or finish treatments. 	U. discover firewall compromises.
B. inspect floor coverings or carpeting.	V. inspect pools, spas or fountains.
C. inspect central vacuum systems.	W. determine the adequacy of whirlpool or spa jets water force, or bubble effects.
D. inspect for safety glazing.	X. determine the structural integrity or leakage of
E. inspect security systems or components.	pools or spas.
F. evaluate the fastening of islands, countertops, cabinets, sink tops or fixtures.	
G. move furniture, stored items, or any coverings, such as carpets or rugs, in order to inspect the concealed floor structure.	
H. move suspended-ceiling tiles.	
I. inspect or move any household appliances.	
11	

APPEN	IDIX				Repor	t No. 5961			
125 Maria Street, Toronto, ON January 20, 2025 www.canspechome							echome.com		
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX									

4. Glossary of Terms

- accessible: In the opinion of the inspector, can be approached or entered safely, without difficulty, fear or danger.
- activate: To turn on, supply power, or enable systems, equipment or devices to become active by normal operating controls. Examples include turning on the gas or water supply valves to the fixtures and appliances, and activating electrical breakers or fuses.
- adversely affect: To constitute, or potentially constitute, a negative or destructive impact.
- alarm system: Warning devices, installed or freestanding, including, but not limited to: carbon-monoxide detectors, flue gas and other spillage detectors, security equipment, ejector pumps, and smoke alarms.
- appliance: A household device operated by the use of electricity or gas. Not included in this definition are components covered under central heating, central cooling or plumbing.
- architectural service: Any practice involving the art and science of building design for construction of any structure or grouping of structures, and the use of space within and surrounding the structures or the design, design development, preparation of construction contract documents, and administration of the construction contract.
- component: A permanently installed or attached fixture, element or part of a system.
- **condition:** The visible and conspicuous state of being of an object.
- correction: Something that is substituted or proposed for what is incorrect, deficient, unsafe, or a defect.
- cosmetic defect: An irregularity or imperfection in something, which could be corrected, but is not required.
- **crawlspace:** The area within the confines of the foundation and between the ground and the underside of the lowest floor's structural component.

- decorative: Ornamental; not required for the operation of essential systems or components of a home.
- **describe:** To report in writing a system or component by its type or other observed characteristics in order to distinguish it from other components used for the same purpose.
- **determine:** To arrive at an opinion or conclusion pursuant to examination.
- **dismantle:** To open, take apart or remove any component, device or piece that would not typically be opened, taken apart or removed by an ordinary occupant.
- engineering service: Any professional service or creative work requiring engineering education, training and experience, and the application of special knowledge of the mathematical, physical and engineering sciences to such professional service or creative work as consultation, investigation, evaluation, planning, design and supervision of construction for the purpose of assuring compliance with the specifications and design, in conjunction with structures, buildings, machines, equipment, works and/or processes.
- enter: To go into an area to observe visible components.
- evaluate: To assess the systems, structures and/or components of a property.
- evidence: That which tends to prove or disprove something; something that makes plain or clear; grounds for belief; proof.
- examine: To visually look (see inspect).
- **foundation:** The base upon which the structure or wall rests, usually masonry, concrete or stone, and generally partially underground.
- **function:** The action for which an item, component or system is specially fitted or used, or for which an item, component or system exists; to be in action or perform a task.
- **functional:** Performing, or able to perform, a function.

APPENDIX Report No. 596									t No. 5961
125 Maria Street, Toronto, ON January 20, 2025 www.canspechome.co								echome.com	
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX									

- functional defect: A lack of or an abnormality in something that is necessary for normal and proper functioning and operation, and, therefore, requires further evaluation and correction.
- general home inspection: The process by which an inspector visually examines the readily accessible systems and components of a home and operates those systems and components utilizing this Standards of Practice as a guideline.
- home inspection: See general home inspection.
- household appliances: Kitchen and laundry appliances, room air conditioners, and similar appliances.
- identify: To notice and report.
- indication: That which serves to point out, show, or make known the present existence of something under certain conditions.
- inspect: To examine readily accessible systems and components safely, using normal operating controls, and accessing readily accessible areas, in accordance with this Standards of Practice.
- inspected property: The readily accessible areas of the buildings, site, items, components and systems included in the inspection.
- inspection report: A written communication (possibly including images) of any material defects observed during the inspection.
- inspector: One who performs a real estate inspection.
- **installed:** Attached or connected such that the installed item requires a tool for removal.
- material defect: A specific issue with a system or component of a residential property that may have a significant, adverse impact on the value of the property, or that poses an unreasonable risk to people. The fact that a system or component is near, at, or beyond the end of its normal, useful life is not, in itself, a material defect.

- normal operating controls: Describes the method by which certain devices (such as thermostats) can be operated by ordinary occupants, as they require no specialized skill or knowledge.
- observe: To visually notice.
- operate: To cause systems to function or turn on with normal operating controls.
- readily accessible: A system or component that, in the judgment of the inspector, is capable of being safely observed without the removal of obstacles, detachment or disengagement of connecting or securing devices, or other unsafe or difficult procedures to gain access.
- recreational facilities: Spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment and athletic facilities.
- report (verb form): To express, communicate or provide information in writing; give a written account of. (See also inspection report.)
- representative number: A number sufficient to serve as a typical or characteristic example of the item(s) inspected.
- **residential property:** Four or fewer residential units.
- **residential unit:** A home; a single unit providing complete and independent living facilities for one or more persons, including permanent provisions for living, sleeping, eating, cooking and sanitation.
- **safety glazing:** Tempered glass, laminated glass, or rigid plastic.
- **shut down:** Turned off, unplugged, inactive, not in service, not operational, etc.
- structural component: A component that supports non-variable forces or weights (dead loads) and variable forces or weights (live loads).
- **system:** An assembly of various components which function as a whole.

APPENDIX								Report No. 5961	
125 Maria Street, Toronto, ON January 20, 2025 www.canspechome.com								echome.com	
EXECUTIVE S	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX									

- technically exhaustive: A comprehensive and detailed examination beyond the scope of a real estate home inspection that would involve or include, but would not be limited to: dismantling, specialized knowledge or training, special equipment, measurements, calculations, testing, research, analysis, or other means.
- **unsafe:** In the inspector's opinion, a condition of an area, system, component or procedure that is judged to be a significant risk of injury during normal, day-to-day use. The risk may be due to damage, deterioration, improper installation, or a change in accepted residential construction standards.
- verify: To confirm or substantiate.

These terms are found within the Standards of Practice. Visit InterNACHI's full Glossary online at <u>http://www.nachi.org/glossary.htm</u>

International Code of Ethics for Home Inspectors

The International Association of Certified Home Inspectors (InterNACHI) promotes a high standard of professionalism, business ethics and inspection procedures. InterNACHI members subscribe to the following Code of Ethics in the course of their business.

I. Duty to the Public

- 1. The InterNACHI member shall abide by the Code of Ethics and substantially follow the InterNACHI Standards of Practice.
- 2. The InterNACHI member shall not engage in any practices that could be damaging to the public or bring discredit to the home inspection industry.
- 3. The InterNACHI member shall be fair, honest and impartial, and act in good faith in dealing with the public.
- The InterNACHI member shall not discriminate in any business activities on the basis of race, color, religion, sex, national origin, familial status, sexual orientation, or handicap, and shall comply with all federal,

state and local laws concerning discrimination.

- 5. The InterNACHI member shall be truthful regarding his/her services and qualifications.
- 6. The InterNACHI member shall not:
 - a. have any disclosed or undisclosed conflict of interest with the client;
 - accept or offer any disclosed or undisclosed commissions, rebates, profits, or other benefit from real estate agents, brokers, or any third parties having financial interest in the sale of the property; or
 - offer or provide any disclosed or undisclosed financial compensation directly or indirectly to any real estate agent, real estate broker, or real estate company for referrals or for inclusion on lists of preferred and/or affiliated inspectors or inspection companies.
- 7. The InterNACHI member shall not release any information about the inspection or the client to a third party unless doing so is necessary to protect the safety of others, to comply with a law or statute, or both of the following conditions are met:
 - the client has been made explicitly aware of what information will be released, to whom, and for what purpose, and;
 - b. the client has provided explicit, prior written consent for the release of his/her information.
- The InterNACHI member shall always act in the interests of the client unless doing so violates a law, statute, or this Code of Ethics.
- 9. The InterNACHI member shall use a written contract that specifies the services to be performed, limitations of services, and fees.
- 10. The InterNACHI member shall comply with all government rules and licensing

requirements of the jurisdiction where he or she conducts business.

11. The InterNACHI member shall not perform or offer to perform, for an additional fee, any repairs or associated services to the structure for which the member or member's company has prepared a home inspection report for a period of 12 months. This provision shall not include services to components and/or systems that are not included in the InterNACHI Standards of Practice.

II. Duty to Continue Education

- 1. The InterNACHI member shall comply with InterNACHI's current Continuing Education requirements.
- 2. The InterNACHI member shall pass InterNACHI's Online Inspector Exam once every three years.

III. Duty to the Profession and to InterNACHI

1. The InterNACHI member shall strive to improve the home inspection industry by sharing his/her lessons and/or experiences for the benefit of all. This does not preclude the member from copyrighting or marketing his/her expertise to other Inspectors or the public in any manner permitted by law.

- 2. The InterNACHI member shall assist the InterNACHI leadership in disseminating and publicizing the benefits of InterNACHI membership.
- 3. The InterNACHI member shall not engage in any act or practice that could be deemed damaging, seditious or destructive to InterNACHI, fellow InterNACHI members, InterNACHI employees, leadership or directors. Accusations of a member acting or deemed in violation of such rules shall trigger a review by the Ethics Committee for possible sanctions and/or expulsion from InterNACHI.
- The InterNACHI member shall abide by InterNACHI's current membership requirements.
- 5. The InterNACHI member shall abide by InterNACHI's current message board rules.

Members of other associations are welcome to join InterNACHI, but a requirement of membership is that InterNACHI must be given equal or greater prominence in their marketing materials (brochures and websites) compared to other associations of membership.